# **Shaft Clamps**

## 23341.0516



## **Product Description**

Shaft clamps are used to clamp round workpieces, e.g. shafts, axels, tubes or rods voth axially and radially.

#### **Material**

## Body

· Stainless steel 1.4305

#### **Spring**

Stainless steel

### Clamping screw

- Steel, zinc-plated
- Stainless Steel

#### **Assembly**


- 1. Expand the clamping jaws to the diameter of the shaft to be clamped.
- 2. Insert shaft clamp into hole using the assembly tool.
- 3. Insert and position the shaft.
- 4. Clamp using cylinder screw WS (observe tightening torque).


### More information

#### **Notes**


The thread  $d_3$  serves to hold the assembly tool (optional).

### **Drawing**



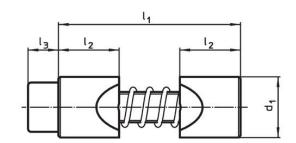

Erwin Halder KG

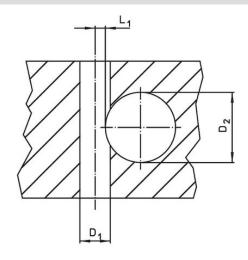

## **Order information**

Dimensions							Tightening torque	Location hole			I	Art. No.
d <sub>1</sub>	d <sub>2</sub>	d <sub>3</sub>	l <sub>1</sub>	l <sub>2</sub>	l <sub>3</sub>		max.	Hub bore	Shaft diameter	L <sub>1</sub>	_	
h11			max.					D <sub>1</sub>	D <sub>2</sub>	+0.2		
								H7				
[mm]						[mm]	[Nm]		[mm]		[g]	
Stainless steel												
16	M8	M5	46	16	8	6	25	16	20 – 30	4	52	23341.0516

#### **Accessories**


	WS	d	i	Art. No.					
	[mm]	[mm]	[9]						
special hexagon key									
	6	M 5	28	23341.1016					





www.halder.com Page 1 of 2


Published on: 3.2.2024

## **Application example**

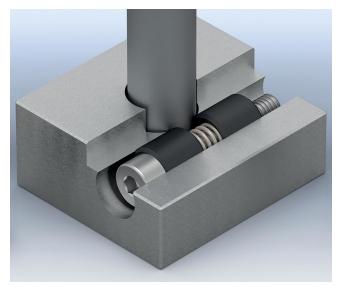

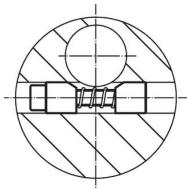

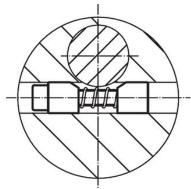

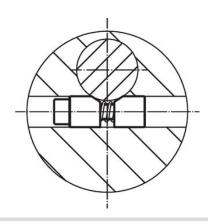

## Compliance

#### **RoHS** compliant

Compliant according to Directive 2011/65/EU and Directive 2015/863.

#### Does not contain SVHC substances

No SVHC substances with more than 0.1% w/w contained - SVHC list [REACH] as of 23.01.2024.

Erwin Halder KG

## Does not contain Proposition 65 substances

No Proposition 65 substances included. https://www.P65Warnings.ca.gov/

### **Free from Conflict Minerals**

This product does not contain any substances designated as "conflict minerals" such as tantalum, tin, gold or tungsten from the Democratic Republic of Congo or adjacent countries.



www.halder.com Page 2 of 2

Published on: 3.2.2024